



[illegible]

Die Sondierung wurde bei 1,5 m wegen zunehmender Schrägstellung der Sondierstangen abgebrochen

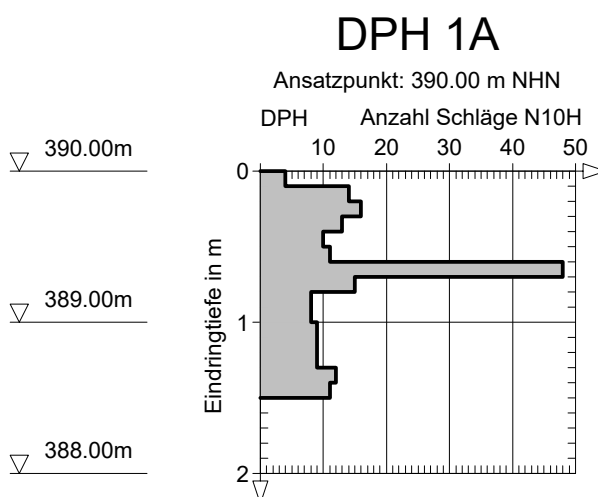


Tiefe	N ₁₀
0.10	25
0.20	15
0.30	18
0.40	15
0.50	12
0.60	9
0.70	7
0.80	5
0.90	5
1.00	4
1.10	6
1.20	7
1.30	5
1.40	6
1.50	6
1.60	4
1.70	8
1.80	6
1.90	5
2.00	8
2.10	7
2.20	5
2.30	3
2.40	3
2.50	2
2.60	2
2.70	2
2.80	2
2.90	11
3.00	5
3.10	4
3.20	6
3.30	6
3.40	6
3.50	9
3.60	10
3.70	14
3.80	23
3.90	6
4.00	5
4.10	8
4.20	8
4.30	22
4.40	22
4.50	20
4.60	14
4.70	11
4.80	8
4.90	8
5.00	12
5.10	79
5.20	55
5.30	42
5.40	21
5.50	110

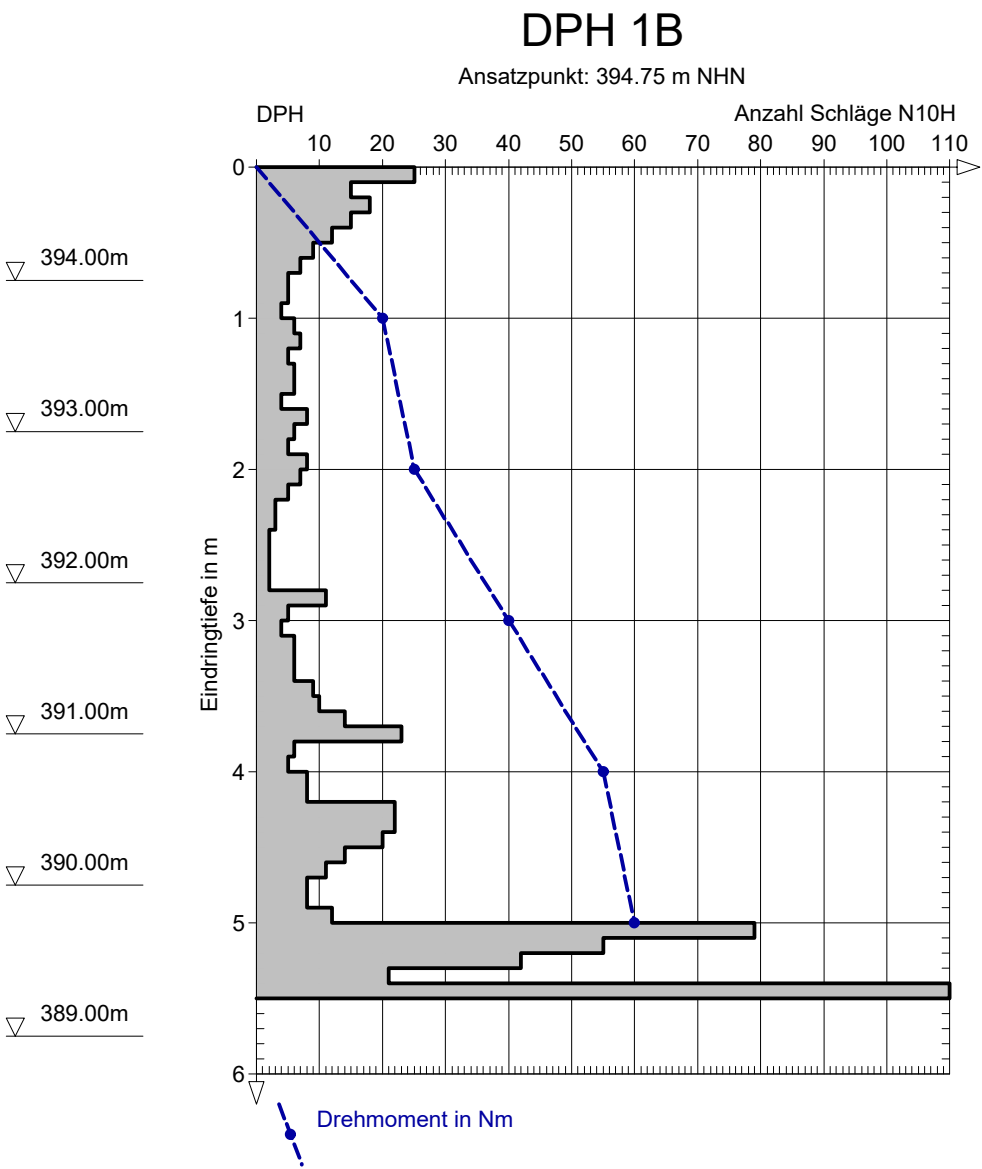



Tiefe	N ₁₀	Tiefe	N ₁₀
0.10	3	6.10	31
0.20	6	6.20	31
0.30	7	6.30	25
0.40	6	6.40	24
0.50	5	6.50	41
0.60	6	6.60	52
0.70	7	6.70	37
0.80	4	6.80	18
0.90	3	6.90	13
1.00	2	7.00	20
1.10	2	7.10	27
1.20	1	7.20	29
1.30	2	7.30	27
1.40	1	7.40	19
1.50	3	7.50	29
1.60	2	7.60	67
1.70	2	7.70	74
1.80	1	7.80	42
1.90	2	7.90	23
2.00	2	8.00	19
2.10	2	8.10	22
2.20	2	8.20	31
2.30	3	8.30	45
2.40	2	8.40	36
2.50	2	8.50	38
2.60	2		
2.70	4		
2.80	4		
2.90	5		
3.00	5		
3.10	4		
3.20	4		
3.30	5		
3.40	9		
3.50	13		
3.60	11		
3.70	11		
3.80	7		
3.90	6		
4.00	9		
4.10	15		
4.20	15		
4.30	11		
4.40	10		
4.50	13		
4.60	13		
4.70	12		
4.80	12		
4.90	17		
5.00	16		
5.10	16		
5.20	16		
5.30	17		
5.40	16		
5.50	15		
5.60	30		
5.70	25		
5.80	27		
5.90	30		
6.00	34		

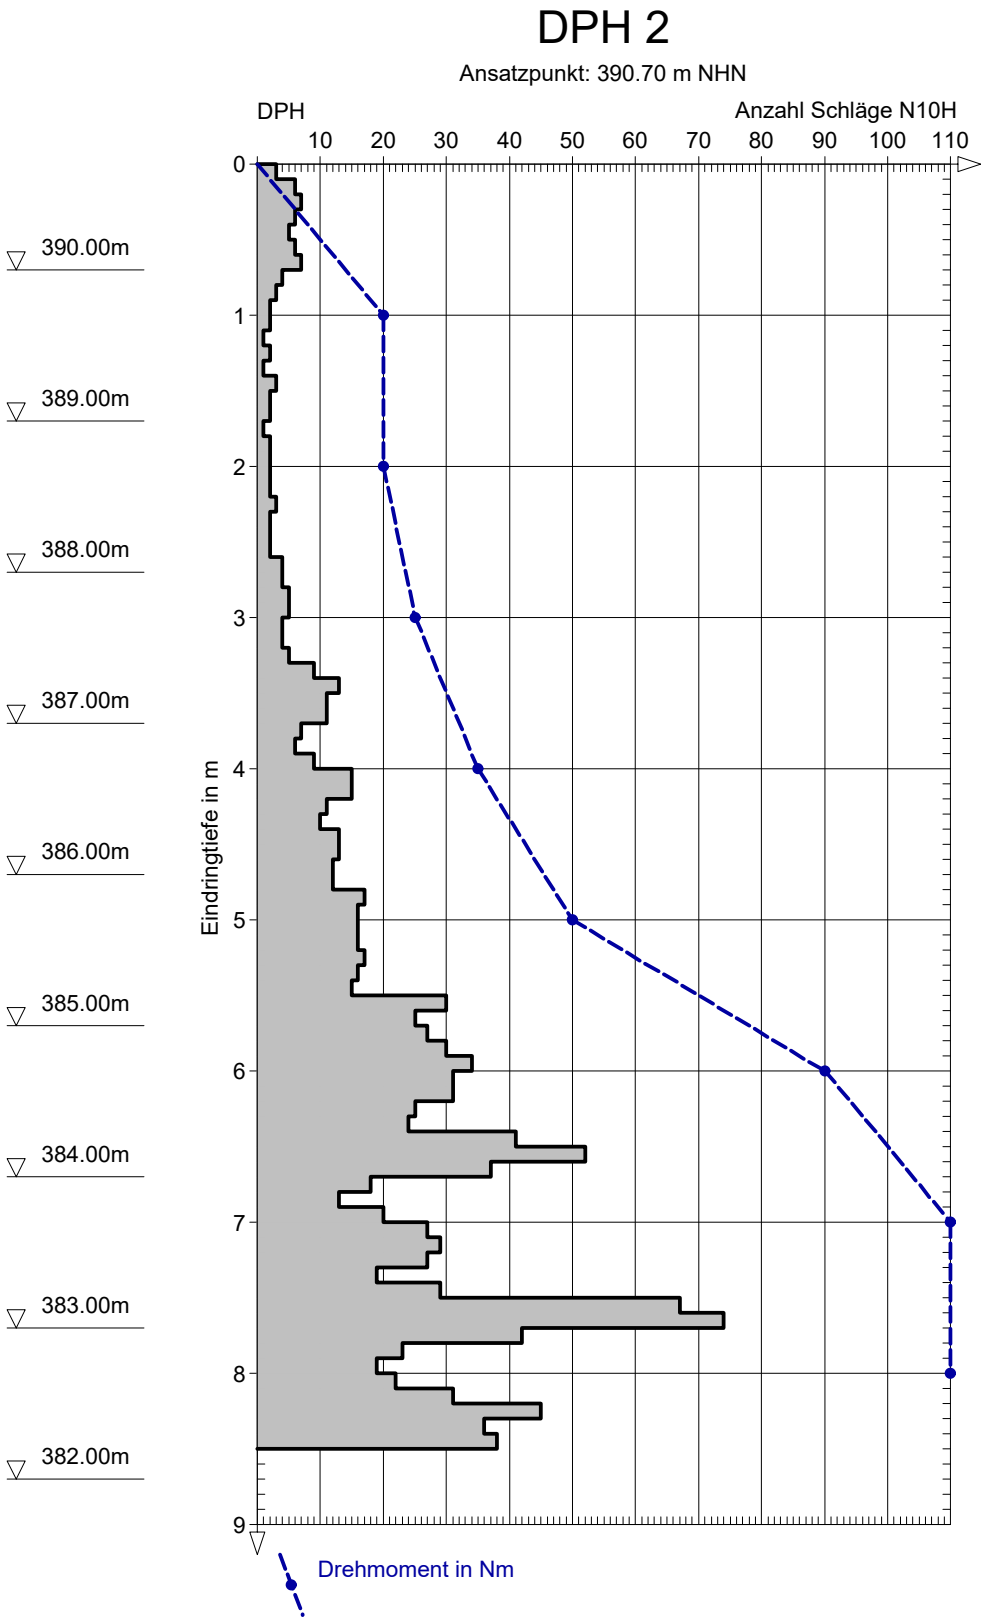



ALTMANN Ingenieures. für Geotechnik,
Grund- und Brunnenbau mbH & Co. KG
St.-Gunther-Straße 4
93413 Cham

Projekt : Seniorenheim St. Michael	
Bericht : 24.GT.118-1	
Bearbeiter : M. Piendl	Datum : 11.11.2024
Maßstab : 1: 50	Anlage : 2.4

Tiefe	N ₁₀
0.10	2
0.20	3
0.30	3
0.40	2
0.50	2
0.60	2
0.70	2
0.80	1
0.90	2
1.00	2
1.10	7
1.20	17
1.30	19
1.40	5
1.50	4
1.60	5
1.70	5
1.80	4
1.90	3
2.00	2
2.10	3
2.20	3
2.30	5
2.40	4
2.50	3
2.60	2
2.70	4
2.80	5
2.90	7
3.00	7
3.10	8
3.20	9
3.30	14
3.40	19
3.50	21
3.60	25
3.70	23
3.80	26
3.90	28
4.00	34
4.10	34
4.20	36
4.30	29
4.40	24
4.50	19
4.60	17
4.70	10
4.80	25
4.90	29
5.00	22
5.10	44
5.20	68
5.30	43
5.40	39
5.50	110

