


Körnungslinie

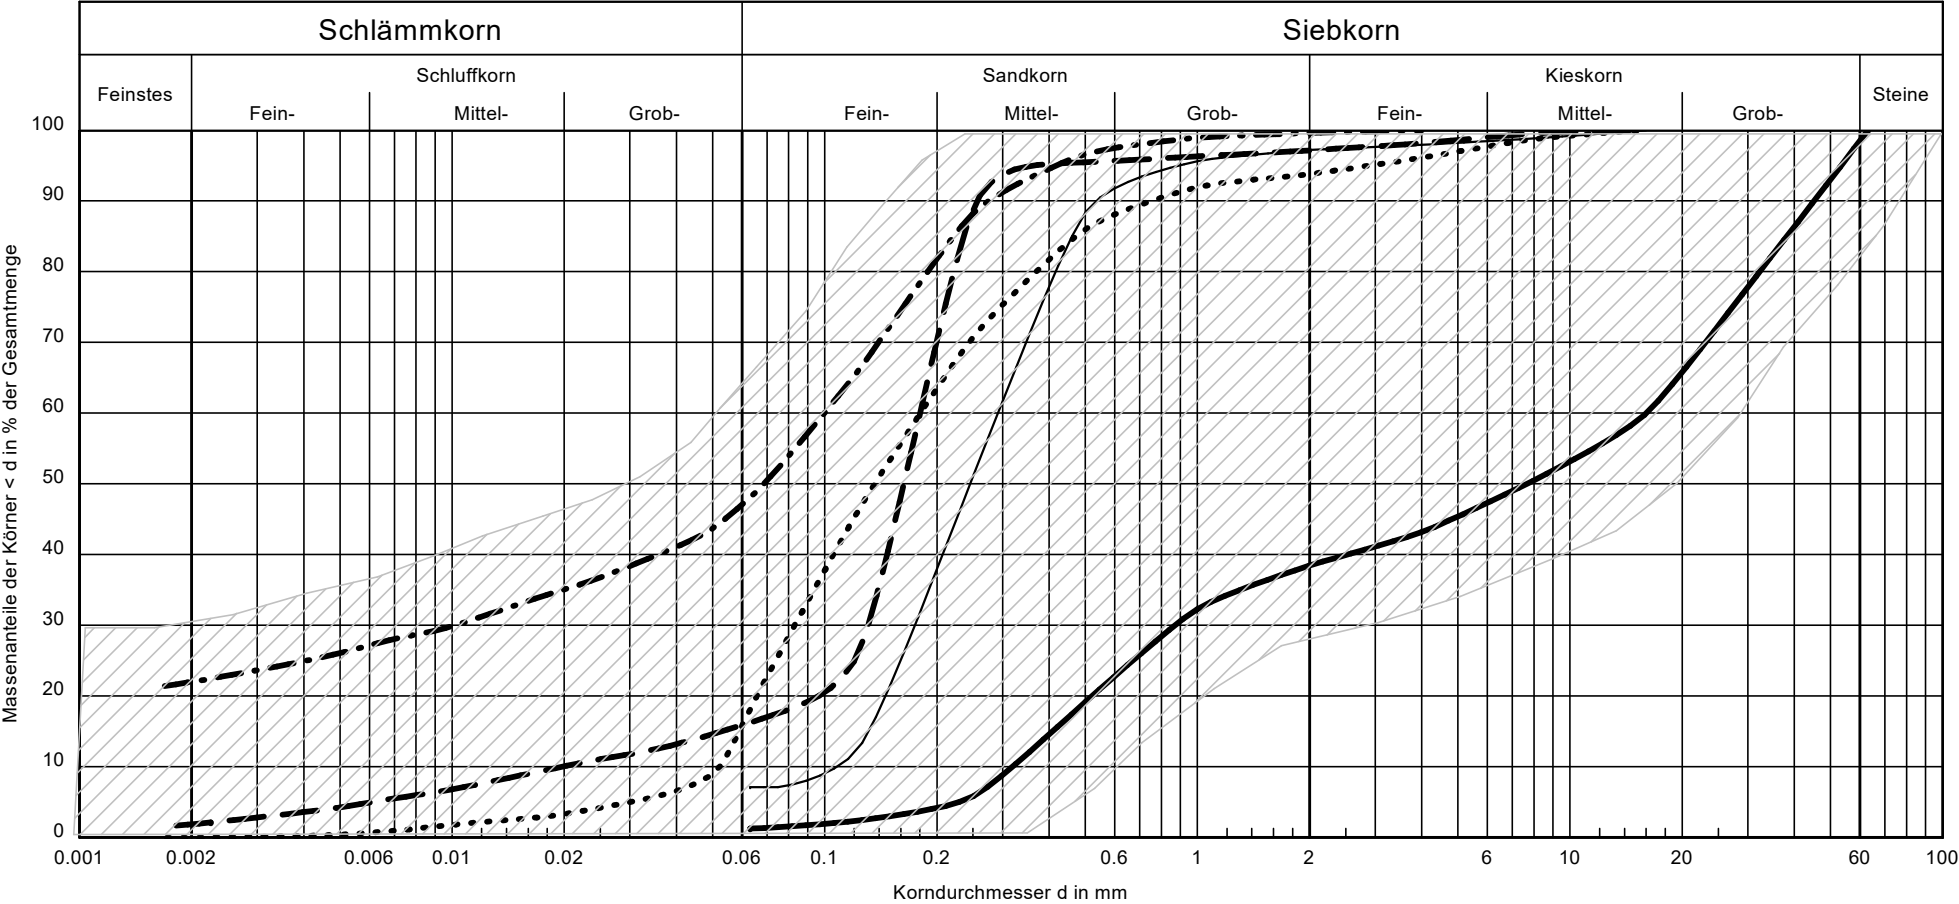


Labor-Nr.	5466	5467	5468	8019	8020
Entnahmestelle	RKS 5*	RKS 4*	RKS 4*	BK 1	BK 1
Entnahmetiefe (m)	0,0 - 0,4	3,4 - 4,5	4,5 - 5,5	0,0 - 0,3	0,3 - 1,2
Bodenart	A (G, s), k+	A (S, u), k+	A (S, t, u), k+	A (S, u, g')	A? (S, u')
Wassergehalt (%)	2,4	9,6	20,8	19,5	18,7
Cu/Cc	50.2/0.1	9.1/4.8	-/-	3.5/0.7	2.7/1.0
Signatur	————	—— — —	— · — · —	········	————

GRUNDBAUINSTITUT BIEDEBACH
Hellerstraße 21
44229 Dortmund
www.gbdo.de

Bearb. - Nr.: 2410
Anlage - Nr.: 52/5.1

Körnungslinie

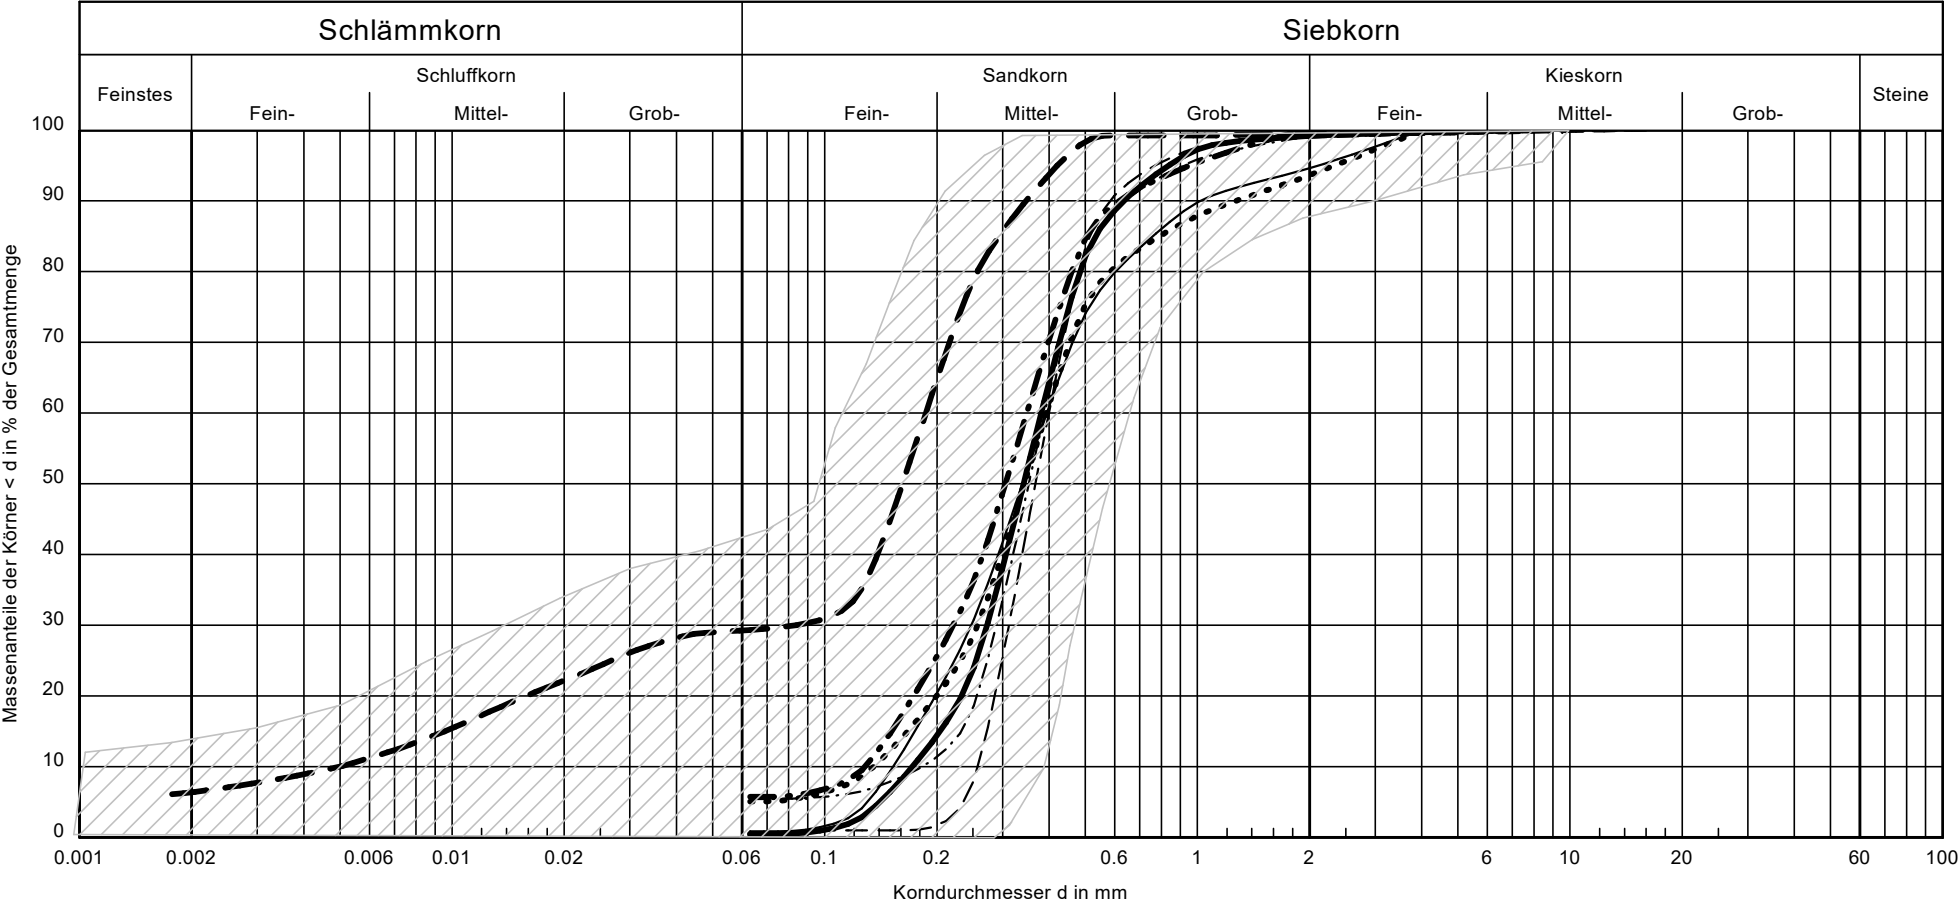

Labor-Nr.	5469	5470	5471	8021	8022	8025	8026
Entnahmestelle	RKS 2*	RKS 2*	RKS 6*	BK 1	BK 1	BK 1	BK 1
Entnahmetiefe (m)	6,0 - 7,1	7,3 - 8,2	5,7 - 7,0	1,2 - 1,7	1,7 - 2,2	3,6 - 4,6	20,8 - 21,5
Bodenart	S	S, u	S, u', o	S, u', g', o	S, g', o	S	S, u'
Wassergehalt (%)	20,2	17,3	28,3	80,2	56,8	15,3	20,0
Cu/Cc	2.2/1.1	37.5/7.5	2.7/1.1	2.9/1.2	2.6/1.0	1.6/0.9	2.1/1.2
Signatur	————	———	— · — · —	······	————	———	— · — · —

GRUNDBAUINSTITUT BIEDEBACH
Hellerstraße 21
44229 Dortmund
www.gbdo.de

Bearb. - Nr.: 2410
Anlage - Nr.: 52/5.2